

Agilent Solutions for Measuring Permittivity and Permeability with LCR Meters and Impedance Analyzers





Solutions for Measuring Permittivity and Permeability with LCR Meters and Impedance Analyzers

Application Note 1369-1

1.	Introduction	3
2.	Permittivity Evaluation	
	2.1. Definition of permittivity	
	2.2. Parallel plate measurement method	
	2.3. Permittivity measurement system	
	2.4. Measurement system using the 16451B dielectric test fixture.	
	2.5. Measurement system using the 16453A dielectric test fixture.	
3.	Permeability Evaluation	
	3.1. Definition of permeability	
	3.2. Inductance measurement method	
	3.3. Permeability measurement system	
	3.4. Measurement system using the 16454A magnetic material test fixture	18
4.	Conclusion	
Аp	pendix	
A.	Permittivity Evaluation of Liquids	21
	A.1. Measurement system using the 16452A liquid test fixture	
	A.1.1. Main advantages	21
	A.1.2. Applicable MUT	21
	A.1.3. Structure	21
	A.1.4. Principal specifications	22
	A.1.5. Operation method	23
	A.1.6. Special considerations	23
Re	ferences	24

1. Introduction

Recently, electronic equipment technology has dramatically evolved to the point where an electronic component's material characteristics becomes a key factor in a circuit's behavior. For example, in the manufacture of high capacitance multilayer ceramic capacitors (MLCCs), which are being used more in digital (media) appliances, employing high к (dielectric constant) material is required. In addition, various electrical performance evaluations, such as frequency and temperature response, must be performed before the materials are selected.

In fields outside of electronic equipment, evaluating the electrical characteristics of materials has become increasingly popular. This is because composition and chemical variations of materials such as solids and liquids can adopt electrical characteristic responses as substituting performance parameters.

A material evaluation measurement system is comprised of three main pieces. These elements include: precise measurement instruments, test fixtures that hold the material under test, and software that can calculate and display basic material parameters, such as permittivity and permeability. Various measurement methods for permittivity and permeability currently exist (see Table 1). However, this note's primary focus will be on methods that employ impedance measurement technology, which have the following advantages:

- Wide frequency range from 20 Hz to 1 GHz
- · High measurement accuracy
- Simple preparations (fabrication of material, measurement setup) for measurement

This note begins by describing measurement methods, systems, and solutions for permittivity in Section 2, followed by permeability in Section 3. The resistivity measurement system and the permittivity measurement system for liquids are described later in the appendix.

Table 1. Measurement technology and methods for permittivity and permeability parameters

Measurement parameter	Measurement technology	Measurement method
	Impedance analysis	Parallel plate
	Network analysis	Reflection wave
Permittivity		S parameters
		Cavity
		Free space
	Impedance analysis	Inductance
Permeability	Network analysis	Reflection wave
		S parameters
		Cavity

2. Permittivity Evaluation

2.1. Definition of permittivity

Permittivity describes the interaction of a material with an electric field. The principal equations are shown in Figure 1. Dielectric constant (κ) is equivalent to the complex relative permittivity (ϵ_{Γ}^*) or the complex permittivity (ϵ^*) relative to the permittivity of free space (ϵ_0). The real part of complex relative permittivity (ε_{r}) is a measure of how much energy from an external field is stored in a material; $\epsilon_{r}' > 1$ for most solids and liquids. The imaginary part of complex relative permittivity $(\epsilon_{\Gamma}^{"})$ is called the loss factor and is a measure of how dissipative or lossy a material is to an external field. ε_{Γ} is always > 0 and is usually much smaller than ϵ_{r} . The loss factor includes the effects of both dielectric loss and conductivity.

When complex permittivity is drawn as a simple vector diagram as shown in Figure 1, the real and imaginary components are 90° out of phase. The vector sum forms an angle δ with the real axis $(\epsilon_{\text{f}}').$ The tangent of this angle, tan δ or loss tangent, is usually used to express the

relative "lossiness" of a material. The term "dielectric constant" is often called "permittivity" in technical literature. In this application note, the term permittivity will be used to refer to dielectric constant and complex relative permittivity.

$$\mathbf{K}^* = \mathbf{\epsilon}^*_{r} = \frac{\mathbf{\epsilon}^*}{\mathbf{\epsilon}_0} = \mathbf{\epsilon}^*_{r} - \mathbf{j} \mathbf{\epsilon}^*_{r} = \left(\frac{\mathbf{\epsilon}^{'}}{\mathbf{\epsilon}_0}\right) - \mathbf{j} \left(\frac{\mathbf{\epsilon}^{"}}{\mathbf{\epsilon}_0}\right)$$

$$\mathbf{\epsilon}^*_{r} = \mathbf{k}^*_{r} \quad \text{tan } \delta = \frac{\mathbf{\epsilon}^*_{r}}{\mathbf{\epsilon}^{'}_{r}} \quad \text{(Imaginary part)}$$

$$\mathbf{k}^* = \mathbf{Dielectic constant}$$

$$\mathbf{\epsilon}^*_{r} = \mathbf{Complex relative permitivity}$$

$$\mathbf{\epsilon}_0 = \frac{\mathbf{Permitivity of }}{\mathbf{free space}} \left(\frac{1}{36\pi} \times 10^{-9} \, [\text{F/m}]\right)$$

Figure 1. Definition of relative complex permittivity (ε_r^*)

2.2. Parallel plate measurement method of measuring permittivity

When using an impedance-measuring instrument to measure permittivity, the parallel plate method is usually employed. An overview of the parallel plate method is shown in Figure 2.

The parallel plate method, also called the three terminal method in ASTM D150, involves sandwiching a thin sheet of material or liquid between two electrodes to form a capacitor. (Note: Throughout the remainder of this document materials under test. whether the material is a solid or a liquid, will be referred to as MUT.) The measured capacitance is then used to calculate permittivity. In an actual test setup, two electrodes are configured with a test fixture sandwiching dielectric material. The impedance-measuring instrument would measure vector components of capacitance (C) and dissipation (D) and a software program would calculate permittivity and loss tangent.

The flow of the electrical field in an actual measurement is shown in Figure 3. When simply measuring the dielectric material between two electrodes, stray capacitance or edge capacitance is formed on the edges of the electrodes and consequently the measured capacitance is larger than the capacitance of the dielectric material. The edge capacitance causes a measurement error, since the current flows through the dielectric material and edge capacitor.

A solution to the measurement error caused by edge capacitance is to use the guard electrode. The guard electrode absorbs the electric field at the edge and the capacitance that is measured between the electrodes is only composed of the current that flows through the dielectric material. Therefore, accurate measurements are possible. When the main electrode is used with a guard electrode, the main electrode is called the guarded electrode.

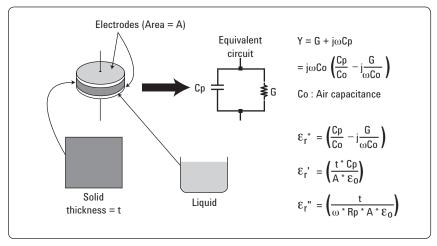


Figure 2. Parallel plate method

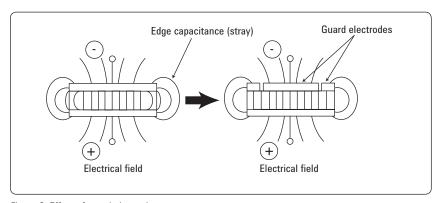


Figure 3. Effect of guard electrode

Contacting electrode method:

This method derives permittivity by measuring the capacitance of the electrodes contacting the MUT directly (see Figure 4). Permittivity and loss tangent are calculated using the equations below:

C_p: Equivalent parallel capacitance of MUT [F]

D: Dissipation factor (measured value)

t_m: Average thickness of MUT [m]

A: Guarded electrode's surface area[m²]

d: Guarded electrode's diameter[m]

 ε_0 : Permittivity of free space = 8.854 x 10⁻¹² [F/m]

Equations:

$$\varepsilon_r = \frac{t_m \times C_p}{A \times \varepsilon_0} = \frac{t_m \times C_p}{\pi \left(\frac{d}{2}\right)^2 \times \varepsilon_0}$$

 $\tan \delta = D$

The contacting electrode method requires no material preparation and the operation involved when measuring is simple. Therefore, it is the most widely used method. However, a significant measurement error can occur if airgap and its effects are not considered when using this method.

When contacting the MUT directly with the electrodes, an airgap is formed between the MUT and the electrodes. No matter how flat and parallel both sides of the MUT are fabricated, an airgap will still form.

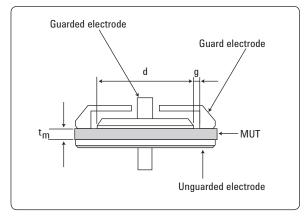


Figure 4. Contacting electrode method

This airgap is the cause for measurement error because the measured capacitance will be the series connection of the capacitance of the dielectric material and the airgap. The relationship between the airgap's thickness and measurement error is determined by the equation shown in Figure 5.

Measurement error is a function of the relative permittivity ($\epsilon r'$) of the MUT, thickness of the MUT (tm), and the airgap's thickness (ta). Sample results of measurement error have been calculated in Table 2. Notice that the effect is greater with thin materials and high κ materials.

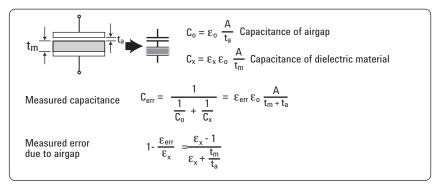


Figure 5. Airgap effects

Table 2. Measurement error caused by airgap

$t_a/t_m^{\epsilon_r'}$	2	5	10	20	50	100	
0.001	0.1%	0.4%	1%	2%	5%	9%	
0.005	0.5%	2%	4%	9%	20%	33%	
0.01	1%	4%	8%	16%	33%	50%	
0.05	5%	16%	30%	48%	70%	83%	
0.1	8%	27%	45%	63%	82%	90%	

This airgap effect can be eliminated, by applying thin film electrodes to the surfaces of the dielectric material. An extra step is required for material preparation (fabricating a thin film electrode), but the most accurate measurements can be performed.

Non-contacting electrode method

This method was conceptualized to incorporate the advantages and exclude the disadvantages of the contacting electrode method. It does not require thin film electrodes, but still solves the airgap effect. Permittivity is derived by using the results of two capacitance measurements obtained with the MUT and without it (Figure 6).

Theoretically, the electrode gap (t_g) should be a little bit larger than the thickness of the MUT (t_m) . In other words, the airgap $(t_g - t_m)$ should be extremely small when compared to the thickness of the MUT (t_m) . These requirements are necessary for the measurement to be performed appropriately. Two capacitance measurements are necessary, and the results are used to calculate permittivity. The equation is shown at right.

C_{s1}: Capacitance without MUT inserted[F]

Cs2: Capacitance with MUT inserted[F]

D1: Dissipation factor without MUT inserted

D2: Dissipation factor with MUT inserted

 $\begin{array}{ll} t_g: & \text{Gap between guarded/guard} \\ & \text{electrode and unguarded electrode } [m] \end{array}$

t_m: Average thickness of MUT [m]

Equations:

$${\epsilon_r^{'}} = \frac{1}{1 - \left(1 - \frac{C_{s1}}{C_{s2}}\right) \times \frac{t_g}{t_m}}$$

$$\tan\,\delta = D_{\rm 2} + {\epsilon_r}' \, {\rm x} \, (D_{\rm 2} - D_{\rm 1}) \, {\rm x} \bigg(\frac{t_g}{t_m} - 1 \bigg) \, ({\rm when} \, \tan\,\delta <<1)$$

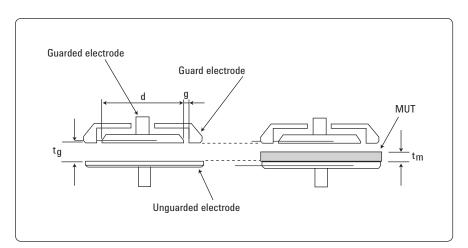


Figure 6. Non-contacting electrode method

Table 3. Comparison of parallel plate measurement methods

Method	Contacting electrode (without thin film electrode)	Non-contacting electrode	Contacting electrode (with thin film electrode)
Accuracy	LOW	MEDIUM	HIGH
Application MUT	Solid material with a flat and smooth surface	Solid material with a flat and smooth surface	Thin film electrode must be applied onto surfaces
Operation	1 measurement	2 measurements	1 measurement

2.3. Permittivity measurement system

Two measurement systems that employ the parallel plate method will be discussed here. The first is the 16451B dielectric test fixture, which has capabilities to measure solid materials up to 30 MHz. The latter is the 16453A dielectric material test fixture, which has capabilities to measure solid materials up to 1 GHz. Details of measurement systems described in this note will follow the subheadings outlined below:

- 1) Main advantages
- 2) Applicable MUT
- 3) Structure
- 4) Principal specifications
- 5) Operation method
- 6) Special considerations
- 7) Sample measurements

2.4. Measurement system using the 16451B dielectric test fixture

2.4.1. Main advantages

- Precise measurements are possible in the frequency range up to 30 MHz
- Four electrodes (A to D) are provided to accommodate the contacting and non-contacting electrode methods and various MUT sizes
- Guard electrode to eliminate the effect of edge capacitance
- Attachment simplifies open and short compensation
- Can be used with any impedancemeasuring instrument with a 4-terminal pair configuration



Applicable measurement instruments: E4990A, 4285A, E4980A, and E4981A


2.4.2. Applicable MUT

The applicable dielectric material is a solid sheet that is smooth and has equal thickness from one end to the other. The applicable dielectric material's size is determined by the measurement method and type of electrode to be used. Electrodes A and B are used for the contacting electrode method without the fabrication of thin film electrodes. Electrodes C and D are used for the contacting electrode method with the fabrication of thin film electrodes. When employing the non-contacting electrode method, electrodes A and B are used. In this method, it is recommended to process the dielectric material to a thickness of a few millimeters.

The difference between electrodes A and B is the diameter (the same difference applies to electrodes C and D). Electrodes A and C are adapted for large MUT sizes, and electrodes B and D are adapted for smaller MUT sizes. The applicable MUT sizes for each electrode are shown in Tables 4 and 5. The dimensions of each electrode are shown in Figures 7 through 10.

Table 4. Applicable MUT sizes for electrodes A and B

Electrode type	Material diameter	Material thickness	Electrode diameter
A	40 mm to 56 mm	t ≤ 10 mm	38 mm
В	10 mm to 56 mm	t ≤ 10 mm	5 mm

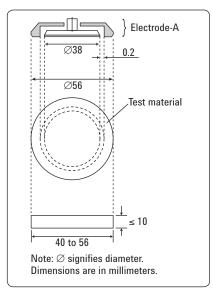

Electrode-B

0.13

0.13

7 Test material

10 to 56

Note: Ø signifies diameter.

Dimensions are in millimeters.

Figure 7. Electrode A dimensions

Figure 8. Electrode B dimensions

Table 5. Applicable MUT sizes for electrodes C and D

Electrode type	Material diameter	Material thickness	Electrode diameter*
C	56 mm	t ≤ 10 mm	5 to 50 mm
D	20 mm to 56 mm	t ≤ 10 mm	5 to 14 mm

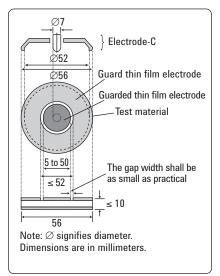


Figure 9. Electrode C dimensions

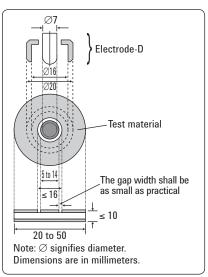


Figure 10. Electrode D dimensions

^{*}Diameter of applied thin film electrodes on surfaces of dielectric material

2.4.3. Structure

In order to eliminate the measurement error caused by edge capacitance, a three-terminal configuration (including a guard terminal) is employed. The structure of the 16451B is shown in Figure 11.

The electrodes in the 16451B are made up of the following:

- 1. Unguarded electrode, which is connected to the measurement instrument's high terminal.
- 2. Guarded electrode, which is connected to the measurement instrument's low terminal.
- 3. Guard electrode, which is connected to the measurement instrument's guard terminal (the outer conductor of the BNC connectors).

The guard electrode encompasses the guarded (or main) electrode and absorbs the electric field at the edge of the electrodes, making accurate permittivity measurements possible.

2.4.4. Principal specifications

Table 6. Principal specifications of the 16451B

Frequency	≤ 30 MHz
Max voltage	±42 V
Operation temperature	0 °C to 55 °C
Terminal configuration	4-terminal pair, BNC
Cable length	1 m
Compensation	Open/short*

The principal specifications are shown in Table 6. Figures 12 and 13 show the measurement accuracy when Agilent's E4990A is used. Further details about the measurement accuracy can be obtained from the Accessories Selection Guide for Impedance Measurements (literature number 5965-4792E)

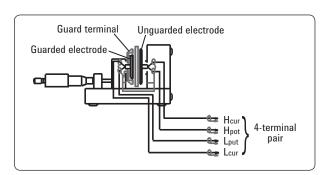


Figure 11. Structure of the 16451B

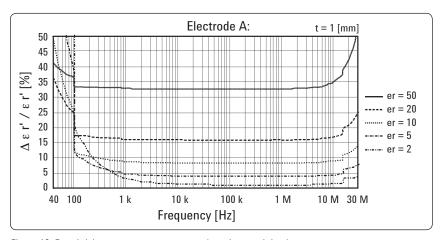


Figure 12. Permittivity measurement accuracy (supplemental data)

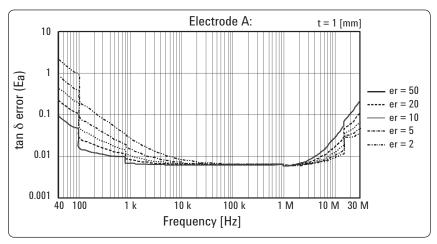


Figure 13. Loss tangent measurement accuracy (supplemental data)

^{*}When using the 4285A or E4990A above 5 MHz, it is necessary to perform load compensation in addition to open and short compensation. For more details, please refer to Section 2.4.5 Operation method.

2.4.5. Operation method

Figure 14 displays the flowchart when using the 16451B for permittivity measurements. Each step in the flowchart is described here:

Step 1. Prepare the dielectric material: Fabricate the MUT to the appropriate size. Use Figures 7 through 10 as references. If the contacting electrode method with thin film electrodes is employed, apply thin film electrodes to the surfaces of the MUT.

Step 2. Attach the guarded electrode: Select the appropriate electrode and fit it into the 16451B.

Step 3. Connect the 16451B: Connect the 16451B to the unknown terminals of the measurement instrument.

Step 4. Cable length compensation: Set the measurement instrument's cable length compensation function to 1 m. Refer to the measurement instrument's operation manual for the setting procedure.

Step 5. Compensate the residual impedance of the 16451B: Use the furnished attachment to perform open and short compensation at a specified frequency. This is necessary before adjusting the guarded and unguarded electrodes to be parallel to each other.

Step 6. Adjust the electrodes: To enhance the measurement performance, a mechanism is provided to adjust the guarded and unguarded electrodes to be parallel to each other. By performing this adjustment, the occurrence of the airgap when using the contacting electrode method is minimized and an airgap with uniform thickness is created when using the non-contacting electrode method. The adjustment procedure is discussed in the operation manual of the 16451B.

Step 7. Set the measurement conditions: Measurement conditions such as frequency and test voltage level are set on the measurement instrument. Refer to the measurement instrument's operation manual for the setting procedure.

Step 8. Compensate the residual impedance of the 16451B: Use the furnished attachment to perform open and short compensation of the measurement conditions set in Step 7.

When using the Agilent 4285A or E4990A above 5 MHz, it is necessary to perform load compensation also. This is because for high frequency measurements, it is difficult to disregard the residual impedance, which cannot be removed by open and short compensation.

In order to compensate the frequency response of the 16451B, a measured value at 100 kHz is used as a standard value and load compensation is performed at high frequencies. The air capacitance formed by creating an airgap between the electrodes (with nothing inserted) is adopted as the load device for the 16451B. Table 7 lists the recommended capacitance values that are obtained by adjusting the height of the airgap between the electrodes. It is assumed that the air capacitance has no frequency dependency, no loss and has a flat response. The capacitance value (Cp) at 100 kHz (G is assumed to be zero) is used for load compensation.

Step 9. Insert MUT: Insert the MUT between the electrodes.

Step 10. Cp-D measurement: The capacitance (Cp) and dissipation factor (D) is measured. When employing the non-contacting electrode method, two Cp-D measurements are performed, with and without the MUT.

Step 11. Calculate permittivity: As previously discussed in Section 2.2, use the appropriate equation to calculate permittivity.

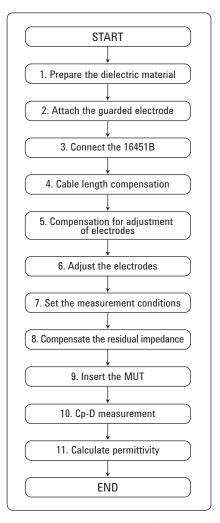


Figure 14. Measurement procedure flowchart for the 16451B

Table 7. Load values

Electrode	Recommended capacitance*
Α	50 pF ± 0.5 pF
В	5 pF ± 0.05 pF
C, D	1.5 pF ± 0.05 pF

^{*} Measured Cp value at 100 kHz

2.4.6 Special considerations

As mentioned before, to reduce the effect of the airgap, which occurs between the MUT and the electrodes, it is practical to employ the contacting electrode method with thin film electrodes (Refer to Section 2.2). Electrodes C and D are provided with the 16451B to carry out this method.

Materials under test that transform under applied pressure cannot keep a fixed thickness. This type of MUT is not suitable for the contacting electrode method. Instead, the non-contacting method should be employed.

When the non-contacting method is employed, the electrode gap $t_{\rm g}$ is required to be at most 10% larger than the thickness of the MUT. It is extremely difficult to create a 10% electrode gap with thin film materials. Therefore, it is recommended that only materials thicker than a few millimeters be used with this method.

The micrometer on the 16451B is designed to make a precise gap when using the non-contacting electrode method. Accurate measurements of the thickness of MUT cannot be made, when employing the contacting electrode method. This is because the micrometer scale is very dependent upon the guard and the unguarded electrodes being parallel. Using a separate micrometer for measuring thickness is recommended.

2.5. Measurement system using the 16453A dielectric material test fixture

2.5.1. Main advantages

- Wide frequency range from 1 MHz – 1 GHz
- Option E4991B-002 (material measurement software) internal firmware in the E4991B solves edge capacitance effect
- Open, short and load compensation
- Direct readouts of complex permittivity are possible with the Option E4991B-002 (material measurement software) internal firmware in the E4991B.
- Temperature characteristics measurements are possible from -55 °C to +150 °C (with Options E4991B-002 and E4991B-007).
- * For temperature-response evaluation, Option E4991B-007 temperature characteristic test kit is required. A Microsoft Excel VBA sample program is pre-installed in the E4991B that provides chamber control and measurement setup functions.

 The sample program can be copied to an external PC.



Applicable measurement instruments: E4991B (Option E4991B-002)

2.5.2. Applicable MUT

The applicable dielectric material is a solid sheet that is smooth and has equal thickness from one end to the other. The applicable MUT size is shown in Figure 15.

2.5.3. Structure

The structure of the 16453A can be viewed in Figure 16. The upper electrode has an internal spring, which allows the MUT to be fastened between the electrodes. Applied pressure can be adjusted as well.

The 16453A is not equipped with a guard electrode like the 16451B. This is because a guard electrode at high frequency only causes greater residual impedance and poor frequency characteristics. To lessen the effect of edge capacitance, a correction function based on simulation results is used in the E4991B, Option E4991B-002 (material measurement) firmware.

Also, residual impedance, which is a major cause for measurement error, cannot be entirely removed by open and short compensation. This is why PTFE is provided as a load compensation device.

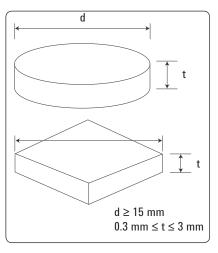


Figure 15. Applicable MUT size

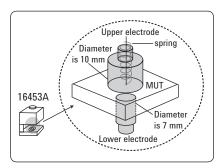


Figure 16. Structure of the 16453A

2.5.4. Principal specifications

Table 8. Principal specifications of the 16453A

Frequency	1 MHz to 1 GHz
Max. voltage	±42 V
Operating temperature	-55 °C to +150 °C
Terminal configuration	7 mm
Compensation	Open, short and load

^{*} Must be accompanied by the E4991B with Options E4991B-002 and E4991B-007.

The principal specifications are shown in Table 8. Figures 17 and 18 show the measurement accuracy when the E4991B is used. Further details about the measurement accuracy can be obtained from the operation manual supplied with the instrument.

2.5.5. Operation method

Figure 19 displays the flowchart when using the 16453A and E4991B for permittivity measurements. The steps in the flowchart are described here. For further details, please refer to the *Quick Start Guide for the E4991B*.

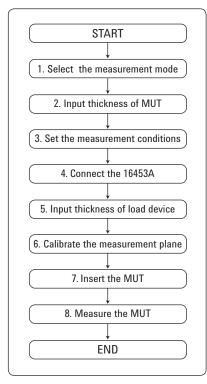


Figure 19. Measurement procedure flowchart for the 16453A

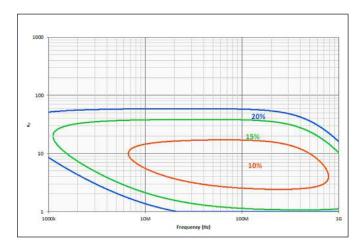


Figure 17. Permittivity measurement accuracy (supplemental data)

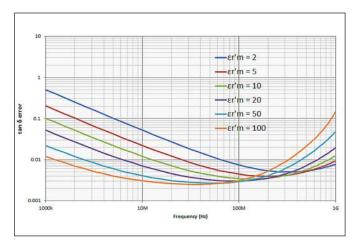


Figure 18. Loss tangent measurement accuracy (supplemental data)

Step 1. Select the measurement mode: Select permittivity measurement in E4991B's utility menu.

Step 2. Input the thickness of MUT: Enter the thickness of the MUT into the E4991B. Use a micrometer to measure the thickness.

Step 3. Set the measurement conditions of the E4991B: Measurement conditions such as frequency, test voltage level, and measurement parameter are set on the measurement instrument.

Step 4. Connect the 16453A: Connect the 16453A to the 7 mm terminal of the E4991B.

Step 5. Input the thickness of load device: Before compensation, enter the furnished load device's (PTFE board) thickness into the E4991B

Step 6. Calibrate the measurement plane: Perform open, short, and load calibration.

Step 7. Insert MUT: Insert the MUT between the electrodes.

Step 8. Measure the MUT: The measurement result will appear on the display. The data can be analyzed using the marker functions.

2.5.6 Special considerations

As with the previous measurement system, an airgap, which is formed between the MUT and the electrodes, can be a primary cause of measurement error. Thin materials and high k materials are most prone to this effect. Materials with rough surfaces (Figure 20) can be similarly affected by airgap.

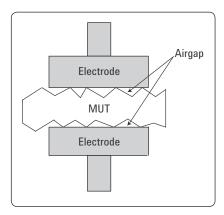


Figure 20. Rough-surfaced dielectric material

There is a technique to apply a thin film electrode onto the surfaces of the dielectric material in order to eliminate the airgap that occurs between the MUT and the electrodes. This technique is shown in Figure 21 and 22 An electrode the exact shape and size to fit the 16453A is fabricated onto the dielectric material using either high-conductivity silver pastes or fired-on silver. The MUT should be shaped as in Figure 21, with the thin film electrode thinner than the dielectric material. In this case, it is vital to appropriately position the fabricated thin film electrode onto the MUT, to precisely contact the electrodes of the 16453A (Figure 22). Following this process will ensure a more accurate and reliable measurement.

In addition, if the MUTs are very thin, for example close to $100~\mu m$, it is possible to stack 3 or 4 other MUTs and then make the measurement. This will reduce the airgap and increase measurement precision. The MUT must be smooth and not transform under applied pressure.

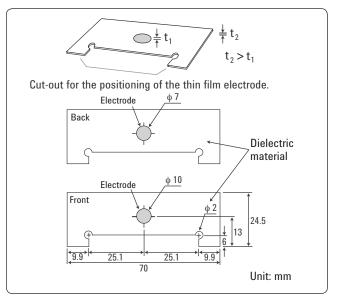


Figure 21. Fabricated thin film electrode's size

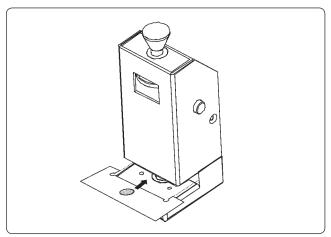


Figure 22. Positioning of the fabricated thin film on the MUT

Another point to consider is the adjusting mechanism of the upper electrode's spring pressure. The spring's pressure should be as strong as possible in order to minimize the occurrence of the airgap between the MUT and the electrodes. However, MUTs which transform under extreme pressure, cannot be measured correctly, since the thickness is affected. To achieve stable measurements, the spring pressure should be set at a level that does not transform the MUT.

2.5.7. Sample measurements

As shown in Figure 23, a measurement result for glass epoxy frequency characteristic can be obtained by using the E4991B with the 16453A.

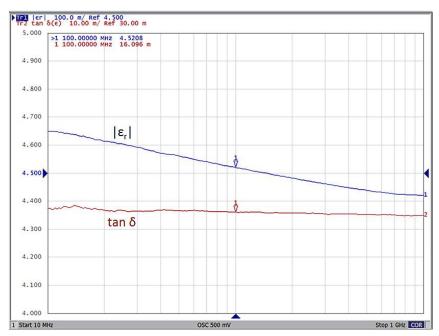


Figure 23. Frequency response of glass epoxy ($\varepsilon_r = 4.5$)

3. Permeability Evaluation

3.1. Definition of permeability

Permeability describes the interaction of a material with a magnetic field. It is the ratio of induction, B, to the applied magnetizing field, H. Complex relative permeability (μ r*) consists of the real part (μ r') that represents the energy storage term and the imaginary part (μ r") that represents the power dissipation term. It is also the complex permeability (μ *) relative to the permeability of free space (μ ₀) as shown in Figure 24.

The inefficiency of magnetic material is expressed using the loss tangent, $\tan \delta$. The $\tan \delta$ is the ratio of $(\mu r')$ to $(\mu r')$. The term "complex relative permeability" is simply called "permeability" in technical literature. In this application note, the term permeability will be used to refer to complex relative permeability.

3.2. Inductance measurement method

Relative permeability of magnetic material derived from the self-inductance of a cored inductor that has a closed loop (such as the toroidal core) is often called effective permeability. The conventional method of measuring effective permeability is to wind some wire around the core and evaluate the inductance with respect to the ends of the wire. This type of measurement is usually performed with an impedance measuring instrument. Effective permeability is derived from the inductance measurement result using the following equations:

$$\mu_e' = \frac{\ell L_{eff}}{\mu_0 N^2 A}$$

$$\mu_e'' = \frac{\ell (R_{eff} - R_w)}{\mu_0 N^2 \omega A}$$

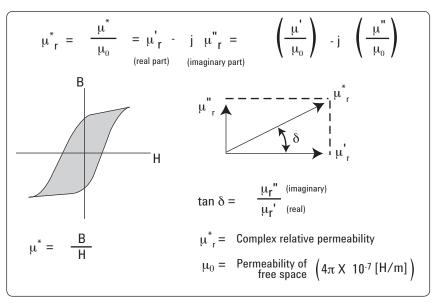


Figure 24. Definition of complex permeability (m*)

 $R_{
m eff}$: Equivalent resistance of magnetic core loss including wire resistance

 L_{eff} : Inductance of toroidal coil

 R_{w} : Resistance of wire only

L_w: Inductance of air-core coil

inductance

N: Turns

Average magnetic path length of toroidal core [m]

A: Cross-sectional area of toroidal core $[m^2]$

 ω : 2π f (frequency)

 μ_0 : $4\pi \times 10^{-7} [H/m]$

Depending on the applied magnetic field and where the measurement is located on the hysteresis curve, permeability can be classified in degree categories such as initial or maximum. Initial permeability is the most commonly used parameter among manufacturers because most industrial applications involving magnetic material use low power levels.

This application note focuses on effective permeability and initial permeability, derived from the inductance measurement method.

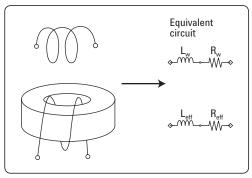


Figure 25. Method of measuring effective permeability

^{*} Some manufacturers use initial permeability even for magnetic materials that are employed at high power levels.


3.3. Permeability measurement system

The next section demonstrates a permeability measurement system using the 16454A magnetic material test fixture.

3.4. Measurement system using the 16454A magnetic material test fixture

3.4.1. Main advantages

- Wide frequency range from 1 kHz to 1 GHz
- Simple measurements without needing a wire wound around the toroid
- Two fixture assemblies are provided for different MUT sizes
- Direct readouts of complex permeability are possible with the E4991B (Option E4991B-002 material measurement software) or with the E4990A.
- * For temperature-response evaluation, Option E4991B-007 temperature characteristic test kit is required. A Microsoft Excel VBA sample program is pre-installed in the E4991B that provides chamber control and measurement setup functions. The sample program can be copied to an external PC. The E4990A does not have a high temperature test head.

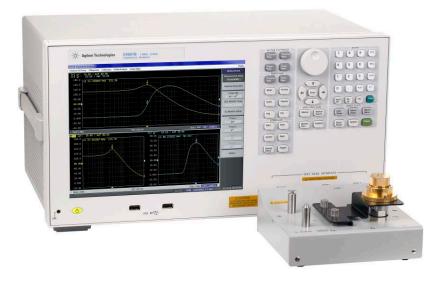

Applicable instruments: E4991B (Option E4991B-002)*, E4990A, and 42942A

 Temperature characteristic measurements are possible from -55 °C to +150 °C (with the E4991B Options E4991B-002 and E4991B-007)

3.4.2. Applicable MUT

The applicable magnetic material can only be a toroidal core. The applicable MUT size is shown in Figure 26.

3.4.3. Structure

The structure of the 16454A and the measurement concept are shown in Figure 27. When a toroidal core is inserted into the 16454A, an ideal,

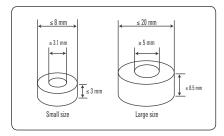


Figure 26. Applicable MUT size

single-turn inductor, with no flux leakage, is formed. Permeability is derived from the inductance of the toroidal core with the fixture.

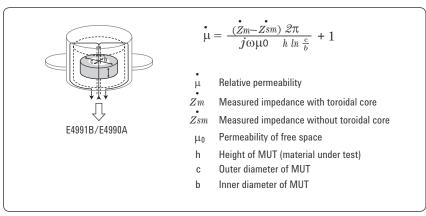


Figure 27. Structure of the 16454A and measurement concept

3.4.4. Principal specifications

Table 9. Principal specifications of the 16454A

Frequency	1 kHz to 1 GHz
Max dc bias current	±500 mA
Operating temperature	-55 °C to +150 °C
Terminal configuration	7 mm
Compensation	Short

Principal specifications of the 16454A are shown in Table 9 above. Figures 28 and 29 show the measurement accuracy when either the E4991B or the E4990A are used.

3.4.5. Operation method

Figure 30 displays the flowchart when using the 16454A for permeability measurements. Each step of the flowchart is described here:

Step 1. Calibrate the measurement instrument: When using the E4991B, calibrate at the 7 mm terminal. When using the E4990A, perform SETUP on the 7 mm terminal of the 42942A.

Step 2. Connect the 16454A: Connect the 16454A to the measurement instrument's 7 mm terminal. When using the E4991B, select the permeability measurement mode.

Step 3. Compensate the residual impedance of the 16454A: Insert only the MUT holder and perform short compensation.

Step 4. Input size of MUT: Enter the size of the MUT into the measurement instrument's menu. Use a micrometer to measure the size.

Step 5. Insert MUT: Insert the MUT with the holder into the 16454A.

Step 6. Set the measurement conditions: Measurement conditions such as frequency, test signal level, and measurement parameter are set on the measurement instrument.

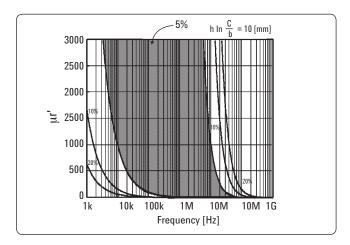


Figure 28. Permeability measurement accuracy (supplemental data)

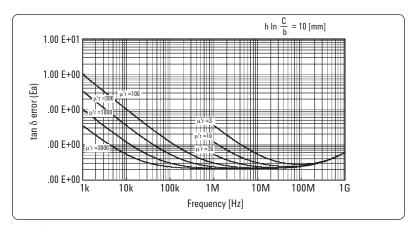


Figure 29. Loss tangent measurement accuracy (supplemental data)

Step 7. Measure the MUT: The measurement result will appear on the display. The data can be analyzed using the marker functions.

Internal firmware comes standard with the material measurement function when using the E4991B (Option E4991B-002). For more details, refer to the *Operation Manual of the E4991B*.

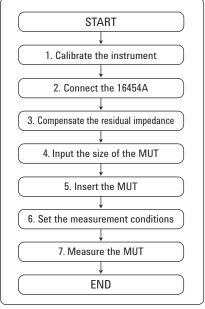


Figure 30. Measurement procedure flowchart for the 16454A

3.4.6. Special considerations

When measuring a magnetic material with a high permittivity (near 10 or above), precise measurements cannot be performed near 1 GHz. Permeability is derived from the inductance value of the combined impedance of the MUT and the fixture. The measured impedance should be composed of inductance and a negligible amount of capacitance. When the magnetic material's permittivity is high, current flows through the space between the MUT and the fixture. This is equivalent to a capacitor connected in parallel to the inductor (of the MUT). This parallel LC circuit causes an impedance-resonance at a destined frequency. The higher the permittivity, the lower the resonant frequency will be and precise measurements will be difficult.

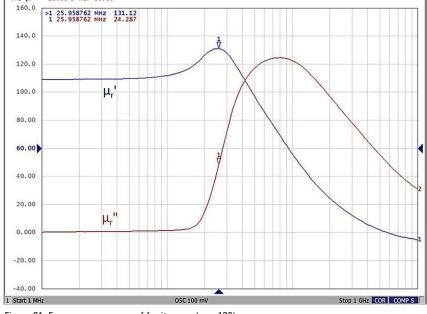


Figure 31. Frequency response of ferrite core ($\mu_r = 120$)

Tr2 ur' 20.00 / Ref 60.00

3.4.7. Sample measurements

Frequency characteristic measurement results of a ferrite core are shown in Figure 31. The E4991B and the 16454A were used to obtain the results in Figure 31.

4. Conclusion

In this application note, permittivity and permeability measurement methods using impedance measurement technology were discussed.

The discussions covered various test fixtures' structures, applicable MUT sizes, operation methods and special considerations. By using this application note as a reference, a measurement solution that satisfies measurement needs and conditions can be selected easily.

Appendix

A. Permittivity Evaluation of Liquids

Permittivity measurements are often used for evaluation of liquid characteristics. Permittivity measurements do not change the liquid physically and can be conducted rather simply and quickly. As a result, they are utilized in a wide array of research areas. Here, the 16452A liquid test fixture, which employs the parallel plate method, will be discussed as a permittivity measurement system for liquids.

A.1. Measurement system using the 16452A liquid test fixture

A.1.1. Main advantages


- Wide frequency range from 20 Hz to 30 MHz
- Plastic resins, oil-based chemical products and more can be measured
- Measurement is possible with a small volume of test liquid so MUT is not wasted
- Temperature characteristic measurements are possible from -20 °C to +125 °C
- Can be used with any impedance measuring instrument that has a 4-terminal configuration.

A.1.2. Applicable MUT

The sample liquid capacity is dependent upon which spacer is used. The spacer adjusts the gap between the electrodes and causes the air capacitance to be altered as well. Table 10 lists the available spacers and the corresponding sample liquid capacities.

A.1.3. Structure

The structure of the 16452A is shown in Figure 32. Three liquid inlets simplify pouring and draining and the fixture can be easily disassembled so that the electrodes can

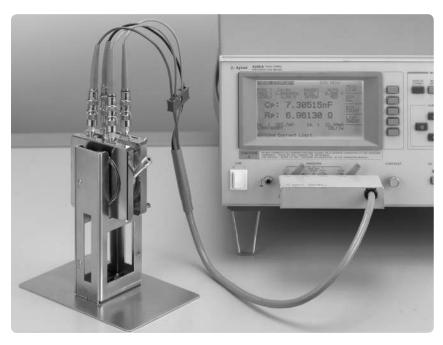

Applicable instruments: E4990A and E4980A

Table 10. Relationship between spacers and liquid capacity

Sample liquid capacity	3.4 ml	3.8 ml	4.8 ml	6.8 ml	
Air capacitance (no liquid present)	34.9 pF	21.2 pF	10.9 pF	5.5 pF	
	±25%	±15%	±10%	±10%	
Spacer thickness	1.3 mm	1.5 mm	2 mm	3 mm	

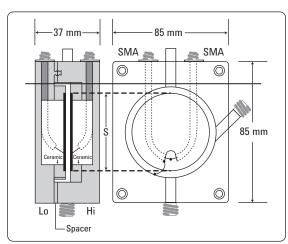


Figure 32. Structure of the 16452A

A 1 m cable is required for connecting to the measurement instrument. Appropriate cables are listed in Table 11.

Table 11. 1 m cables for the 16452A

Temperature	Part number		
0 °C to 55 °C	16048A		
-20 °C to 125 °C	16452-61601		
-20 °C to 125 °C	16048G (E4990A only)		

A.1.4. Principal specifications

Table 12. Principal specifications of the 16452A

Frequency	20 Hz to 30 MHz
Max voltage	± 42 V
Operating temperatures	-20 °C to 125 °C
Terminal configuration	4-terminal pair, SMA
Compensation	Short

The principal specifications of the 16452A are shown in Table 12 and the measurement error is calculated using the following equation.

Measurement accuracy = A + B + C [%]

Error A: see Table 13

Error B: when $\epsilon_r'=1$; see Figure 33

Error C: error of measurement instrument

Table 13. Error A

Spacer thickness (mm)		B (%)
1.3	0.005 x MRP	
1.5	0.006 x MRP	
2.0	0.008 x MRP	
3.0	0.020 x MRP	

M.R.P is measurement relative permittivity

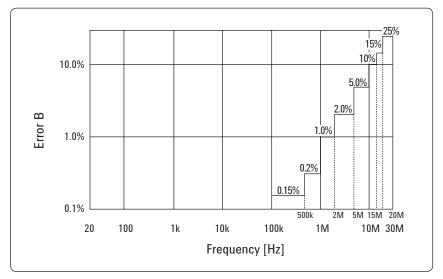


Figure 33. Relative measurement accuracy (supplemental data)

A.1.5. Operation method

Figure 34 displays the flowchart when using the 16452A for permittivity measurements of liquids. Each step of the flowchart is described here:

Step 1. Assemble the 16452A and insert the shorting plate: While attaching the high and low electrodes, insert the shorting plate between them. Next, prepare the 16452A for measurement by connecting the SMA-BNC adapters to the terminals of the fixture and putting the lid on the liquid outlet.

Step 2. Connect the 16452A to the measurement instrument: Select the appropriate 1 m cable depending on the operating temperature and the measurement instrument. Connect the 16452A to the UNKNOWN terminals of the measurement instrument.

Step 3. Compensate the cable length: Set the measurement instrument's cable length compensation function to 1 m. Refer to the measurement instrument's operation manual for the setting procedure.

Step 4. Check the short residual of the 16452A: To verify whether the 16452A was assembled properly, measure the shorting plate at 1 MHz and check if the value falls within the prescribed range. Perform this verification before short compensation. For further details, refer to the *Operation Manual* provided with the 16452A.

Step 5. Set the measurement conditions: Measurement conditions such as frequency and test voltage level are set on the measurement instrument. The measurement parameter should be set to Cp-Rp. Refer to the measurement instrument's operation manual for the setting procedure.

Step 6. Perform short compensation: Perform short compensation with the shorting plate inserted between the electrodes.

Step 7. Measure the air capacitance: Remove the shorting plate, and insert the appropriate spacer required for the sample liquid volume. The air capacitance that exists between the electrodes is measured with the parameter Cp-Rp.

Step 8. Pour liquid in: Pour the liquid into the inlet of the fixture.

Step 9. Measure liquid: Perform a Cp-Rp measurement with the liquid in the fixture.

Step 10. Calculate permittivity: Permittivity and loss factor is calculated using the following equations:

$$\varepsilon_r' = \frac{C_p}{C_0}$$
 $\varepsilon_r'' = \frac{1}{\omega C_0 R_p}$

C_p: Equivalent parallel capacitance of MIIT (F)

C₀: Equivalent parallel capacitance of air [F]

 R_p : Equivalent parallel resistance of MUT $[\Omega]$

 ω : 2 π f (frequency)

Step 11. Drain liquid out: Drain the liquid out from the outlet of the fixture.

A.1.6. Special considerations

There is a high possibility that liquids with bulk conductivity such as salt (Na+ Cl-) or ionic solutions cannot be measured. This is due to the electrode polarization phenomenon, which causes incorrect capacitance measurements to occur for these types of liquids. Even for low frequency measurements of liquids that do not have bulk conductivity, such as water, there is a high possibility that electrode polarization will occur.

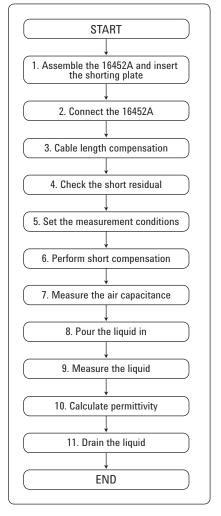


Figure 34. Measurement procedure flowchart for the 16452A

References

- 1. ASTM, "Test methods for A-C loss characteristics and permittivity (dielectric constant) of solid electrical insulating materials," ASTM Standard D 150, American Society for Testing and Materials
- 2. ASTM, "Test methods for D-C resistance or conductance of insulating materials," ASTM Standard D 257, American Society for Testing and Materials
- 3. Application Note 1297, "Solutions for measuring permittivity and permeability," Agilent literature number 5965-9430E
- 4. Application Note 380-1, "Dielectric constant measurement of solid materials using the 16451B dielectric test fixture," Agilent literature number 5950-2390
- 5. Accessories Selection Guide for Impedance Measurements, Agilent literature number 5965-4792E
- 6. Agilent 16451B Operation and Service Manual, PN 16451-90020
- 7. Agilent 16452A Operation and Service Manual, PN 16452-90000
- 8. Agilent 16454A Operation and Service Manual, PN 16454-90020

Web resources

Please visit our website at:

www.agilent.com/find/impedance

for more information about impedance test solutions,

www.agilent.com/find/lcrmeters for more information about lcr meters.

For more information about material analysis visit: www.agilent.com/find/materials



myAgilent

www.agilent.com/find/myagilent

A personalized view into the information most relevant to you.



www.lxistandard.org

LAN eXtensions for Instruments puts the power of Ethernet and the Web inside your test systems. Agilent is a founding member of the LXI consortium.





www.agilent.com/find/ThreeYearWarranty

Beyond product specification, changing the ownership experience.

Agilent is the only test and measurement company that offers three-year warranty on all instruments, worldwide



www.agilent.com/quality

Agilent Electronic Measurement Group DEKRA Certified ISO 9001:2008 Quality Management System

Agilent Channel Partners

www.agilent.com/find/channelpartners

Get the best of both worlds: Agilent's measurement expertise and product breadth, combined with channel partner convenience.

www.agilent.com

For more information on Agilent Technologies' products, applications or services, please contact your local Agilent office. The complete list is available at:

www.agilent.com/find/contactus

Americas

Canada	(877) 894 4414
Brazil	(11) 4197 3600
Mexico	01800 5064 800
United States	(800) 829 4444

Asia Pacific

Australia	1 800 629 485
China	800 810 0189
Hong Kong	800 938 693
India	1 800 112 929
Japan	0120 (421) 345
Korea	080 769 0800
Malaysia	1 800 888 848
Singapore	1 800 375 8100
Taiwan	0800 047 866
Other AP Countries	(65) 375 8100

Europe & Middle East

Belgium	32 (0) 2 404 93 40
Denmark	45 45 80 12 15
Finland	358 (0) 10 855 2100
France	0825 010 700*
	*0.125 €/minute
Germany	49 (0) 7031 464 6333
Ireland	1890 924 204
Israel	972-3-9288-504/544
Italy	39 02 92 60 8484
Netherlands	31 (0) 20 547 2111
Spain	34 (91) 631 3300
Sweden	0200-88 22 55
United Kingdom	44 (0) 118 927 6201

For other unlisted countries:

www.agilent.com/find/contactus

(BP-09-27-13)

Product specifications and descriptions in this document subject to change without notice.

© Agilent Technologies, Inc. 2013 - 2014 Published in USA, May 28, 2014 5980-2862EN

